


WIRING DIAGRAM

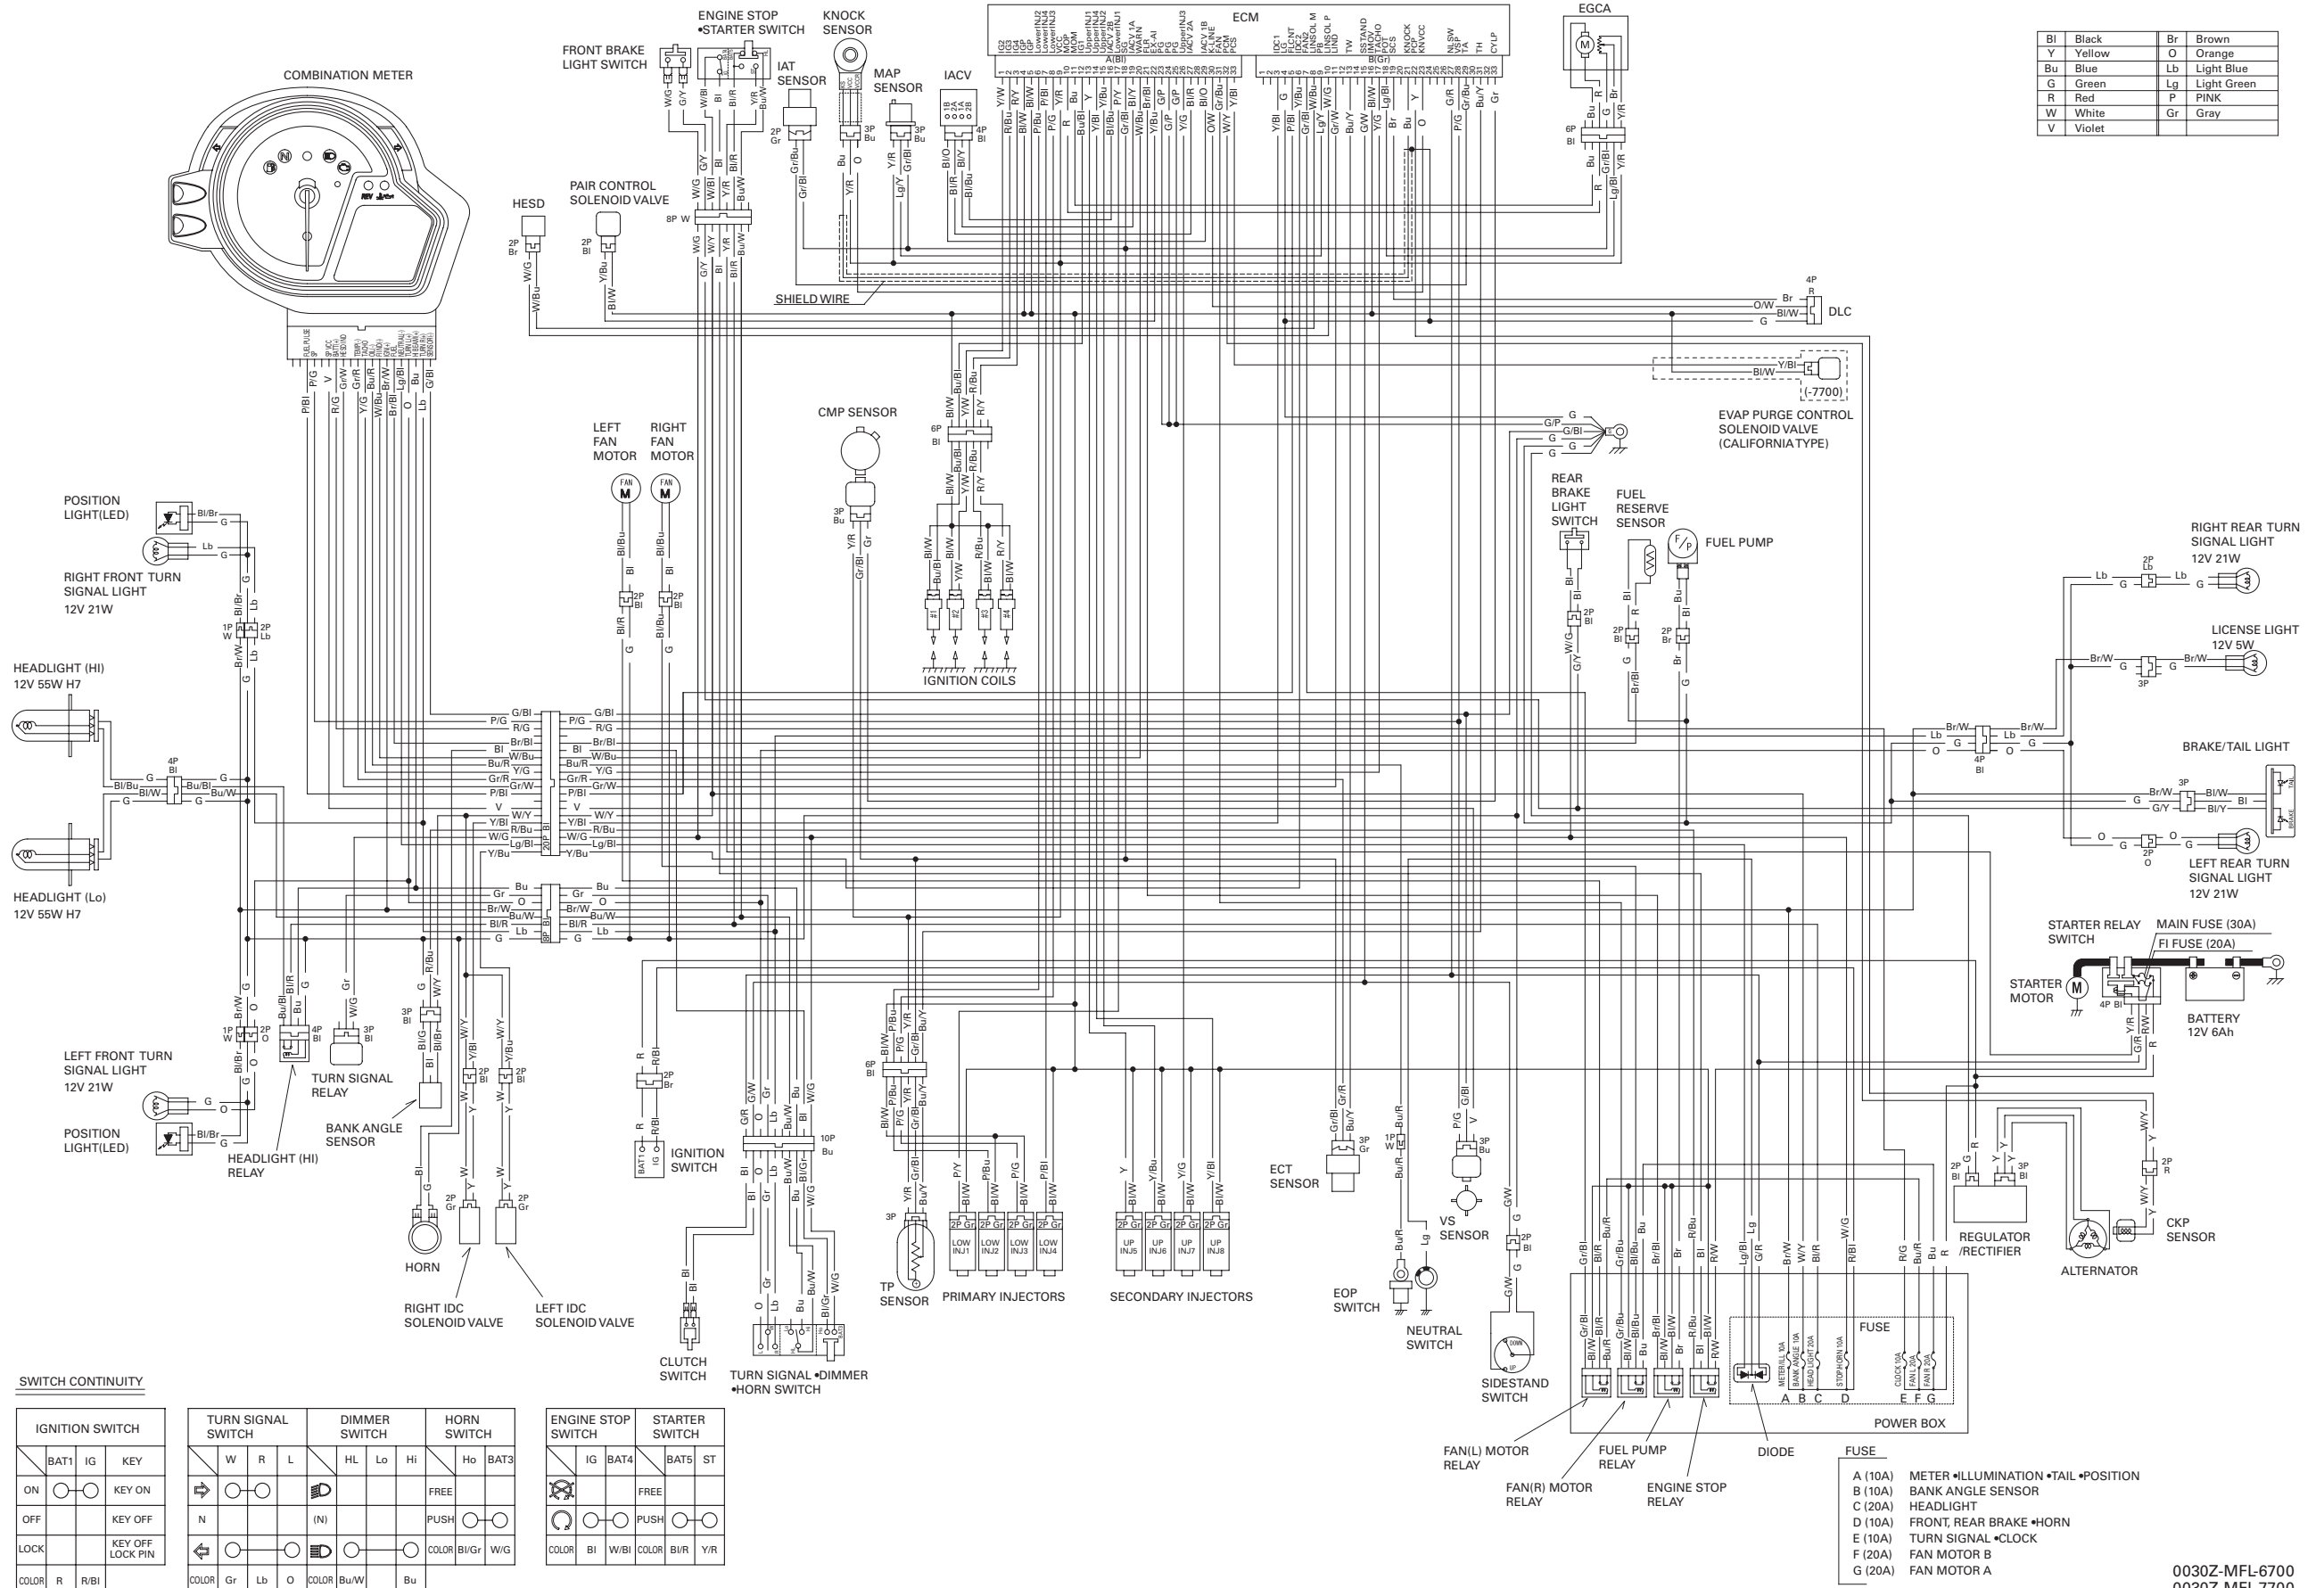

Bl	Black	Br	Brown
Y	Yellow	O	Orange
Bu	Blue	Lb	Light Blue
G	Green	Lg	Light Green
R	Red	P	PINK
W	White	Gr	Gray
V	Violet		

SWITCH CONTINUITY

IGNITION SWITCH		TURN SIGNAL SWITCH			DIMMER SWITCH			HORN SWITCH		ENGINE STOP SWITCH		STARTER SWITCH			
	BAT1	IG	KEY	W	R	L	HL	Lo	Hi	Ho	BAT3	IG	BAT4		
ON	○	○	○	○	○	○	○	○	○	○	○	○	○		
OFF	○	○	○	○	○	○	(N)	○	○	○	○	○	○		
LOCK	○	○	○	○	○	○	○	○	○	○	○	○	○		
COLOR	R	R/BI		Gr	Lb	O	COLOR	Bu/W	Bu	COLOR	BI	W/BI	COLOR	B/R	Y/R

FUSE	DESCRIPTION
A (10A)	METER • ILLUMINATION • TAIL • POSITION
B (10A)	BANK ANGLE SENSOR
C (20A)	HEADLIGHT
D (10A)	FRONT, REAR BRAKE • HORN
E (10A)	TURN SIGNAL • CLOCK
F (20A)	FAN MOTOR B
G (20A)	FAN MOTOR A

0030Z-MFL-6700
0030Z-MFL-7700